


Size	90	125	160	200
Arnold Mat Mechanical	020 120 090	020 120 125	020 120 160	020 120 200
Arnold Mat Mechanical with power preset		020 130 125	020 130 160	020 130 200
Clamping force (kN)	25	40	50	50
A	300	410	570	570
B	387	524	679	679
B (with power preset)		551	706	706
C - 0,02	75	100	110	110
D	115	140	160	173
E	91	126	161	201
F	21	21	21	21
G H7	20	24	24	24
H	70	100	115	119
I	67	124	128	132
J + 0,02	40	90	115	111
K	110	190	230	230
L	40	50	60	60
M H7	20	20	20	20
N	40	40	50	63
U	38	54	68	68
V	11	13	13	13
W	90	125	140	140
X	150	195	300	300
Weight (kg)	16	35	70	93
Clampings	90	125	160	200
Clamping field 01	0-128	0-200	0-310	0-302
Clamping field 02	76-204	80-285	106-416	114-416
Clamping field 03		155-355	174-484	182-484
Clamping field 04	118-172	122-191	165-334	169-334
Clamping field 05		192-261	233-402	237-402
Spare spindle	90	125	160	200
Arnold Mat Mechanical	812 000 090	812 000 125	812 000 160	812 000 200
Arnold Mat Mechanical with power preset		813 000 125	813 000 160	813 000 200

Clamping possibilities



Clamping field 01

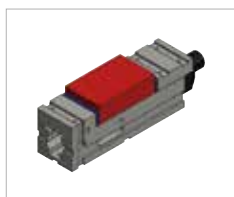

Clamping field 02



Clamping field 03



Clamping field 04



Clamping field 05

Zero point system preinstallation

This vice includes preinstallation for **O-MAK** zero point system.

